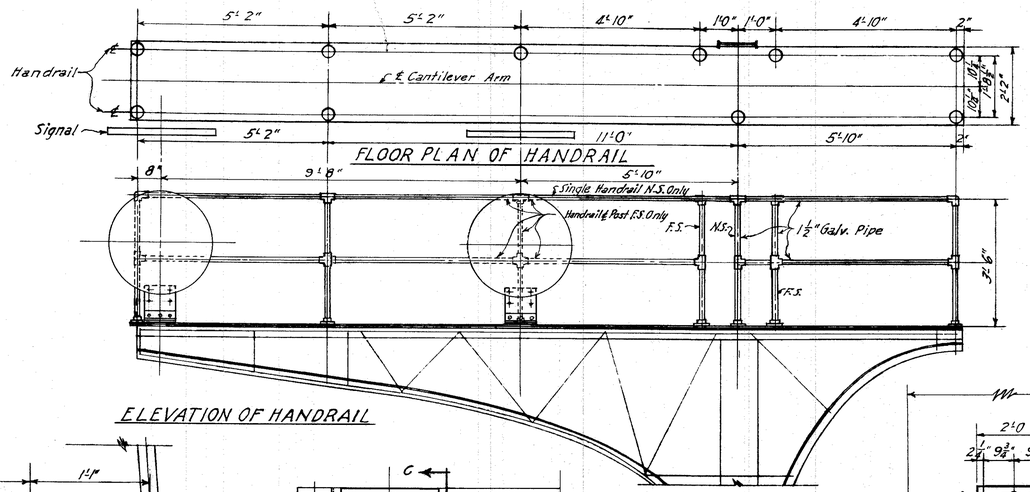

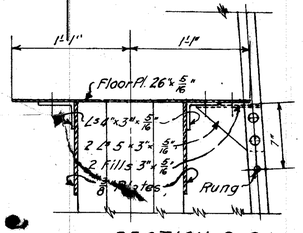

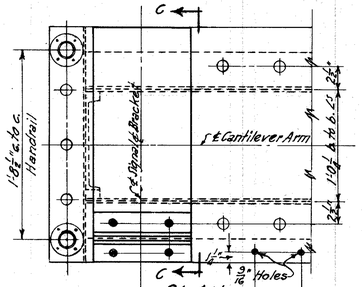

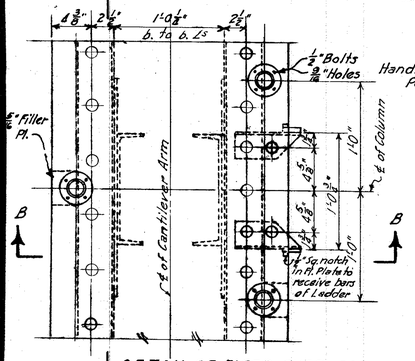

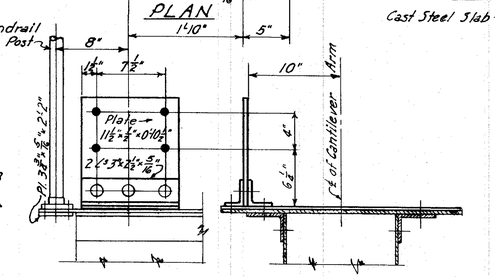

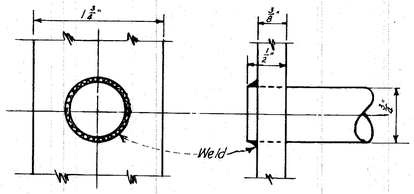

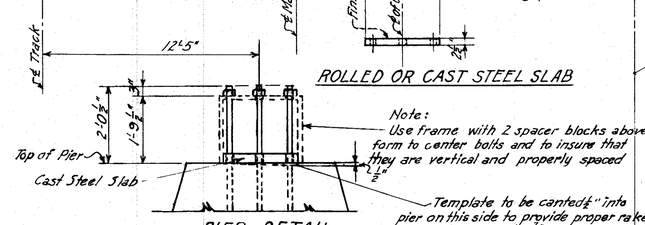

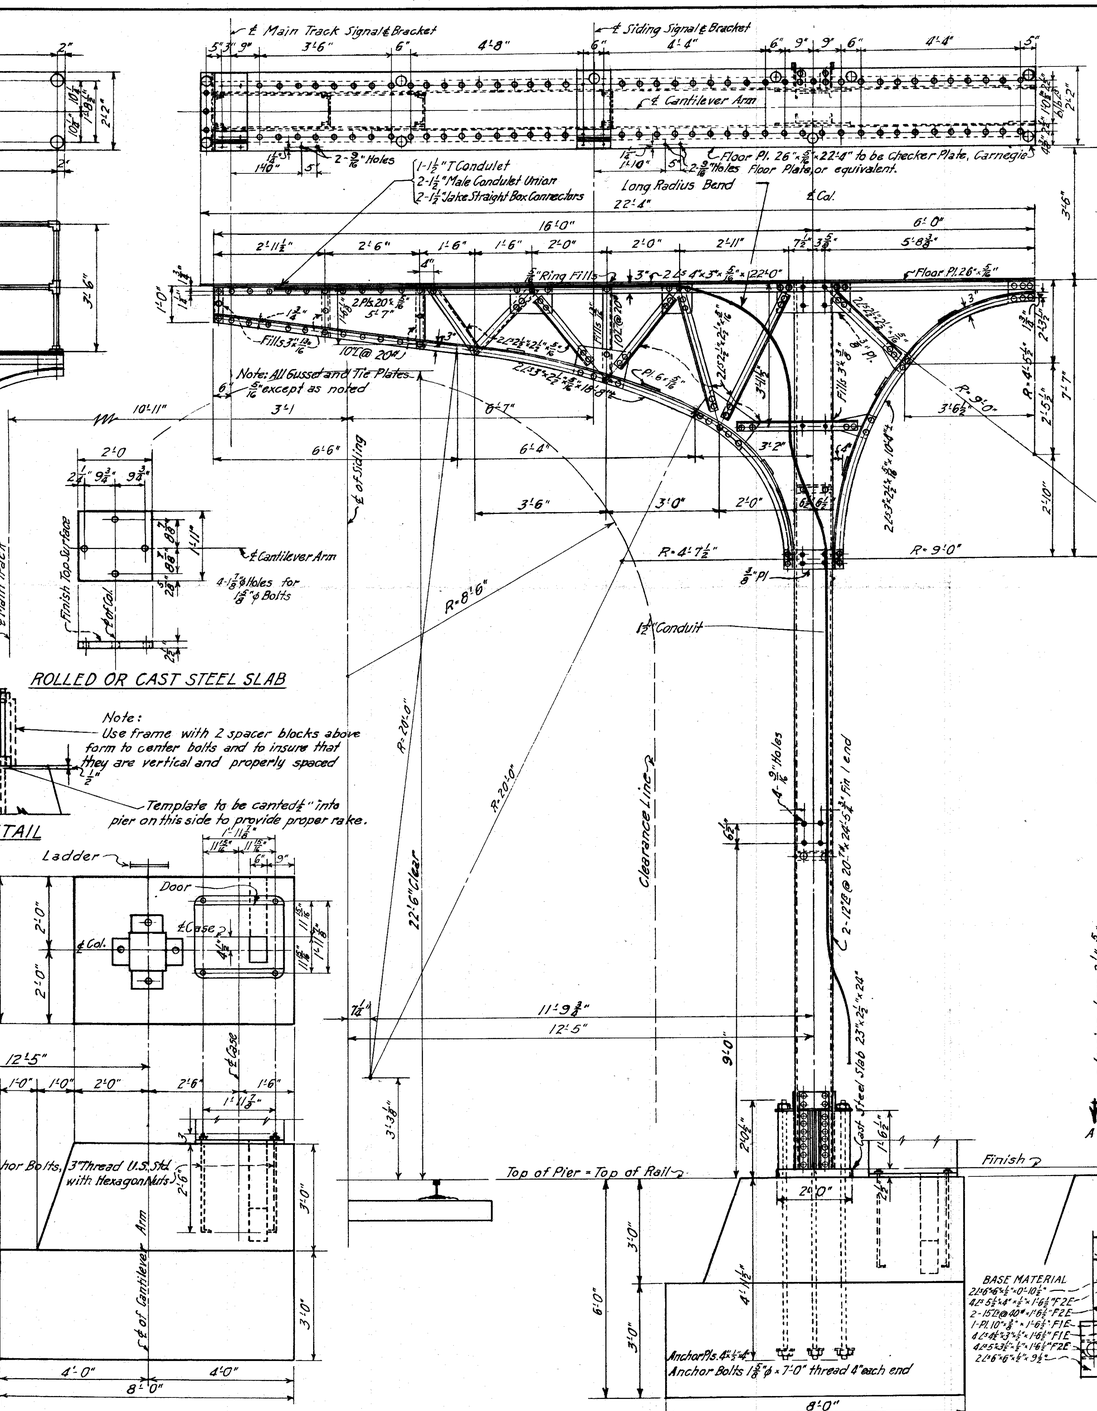

Note:
Rivets ¾" ϕ, Open Holes ⅞" ϕ except as noted.
Pipe fittings to be galv. malleable iron. Tees and Crosses are not to be threaded in the run, but bored to sliding fit. Use ½" dia. pins to connect rails and posts. All holes in pipe rails to be drilled in field to match holes in fittings. Rail post sections to be screwed.
Conduit and Conduit Fittings to be supplied by fabricator when so ordered.

Location	Date	Location	Date
Klamath Falls to Crescent Lake Set Back Signals (C.T.C.)	1952		

SOUTHERN PACIFIC COMPANY
Pacific Lines

TYPICAL CANTILEVER SIGNAL MAST
16 FT. ARM

No Scale S. R. Oct. 21, 1952.

C.E.
Drawing 30461
Sheet 1

F.D.J. 10/29/52

Drawer 1065